

# MODIFICATION INSTRUCTIONS

## for the

### *Kodak* MINILOADER 2000P

### Service Code: 3479

## Modification No. 13

### Type 1 Required

**Purpose:** To install a new SAFETY COVER on all MINILOADER 2000P with the *Kodak Min-R* MAMMOGRAPHY PROCESSOR and the *Kodak Min-R* MAMMOGRAPHY INTEGRATED PROCESSOR. This is a safety requirement for **Canada only**.



#### **Important**

Qualified service personnel must install this modification.

**Service Effects:** None

**Special Requirements:** None

**Serial Numbers:**

- 5000 and higher with the *Kodak Min-R* MAMMOGRAPHY PROCESSOR
- 250,000 - 250,045 with the *Kodak Min-R* MAMMOGRAPHY INTEGRATED PROCESSOR

**Installation Time:** 1 hour

**Special Tools:** None

**Parts Status:** Available from Service Parts Management.

**Parts Requirements:** See [Page 2](#).



---

**PLEASE NOTE**

The information contained herein is based on the experience and knowledge relating to the subject matter gained by Eastman Kodak Company prior to publication.

No patent license is granted by this information.

Eastman Kodak Company reserves the right to change this information without notice, and makes no warranty, express or implied, with respect to this information. Kodak shall not be liable for any loss or damage, including consequential or special damages, resulting from any use of this information, even if loss or damage is caused by Kodak's negligence or other fault.



This equipment includes parts and assemblies sensitive to damage from electrostatic discharge. Use caution to prevent damage during all service procedures.

---

**MODIFICATION KIT 6F6003 includes:**


Part No.	Description	Quantity
9311931	LABEL	1
9311701	SAFETY COVER - black	1
6F6195	MODIFICATION INSTRUCTIONS	1

## Installing the Modification



### Important

- This procedure is for Canada only.
- You must only do this procedure for the MINILOADER 2000P with a MAMMOGRAPHY PROCESSOR.

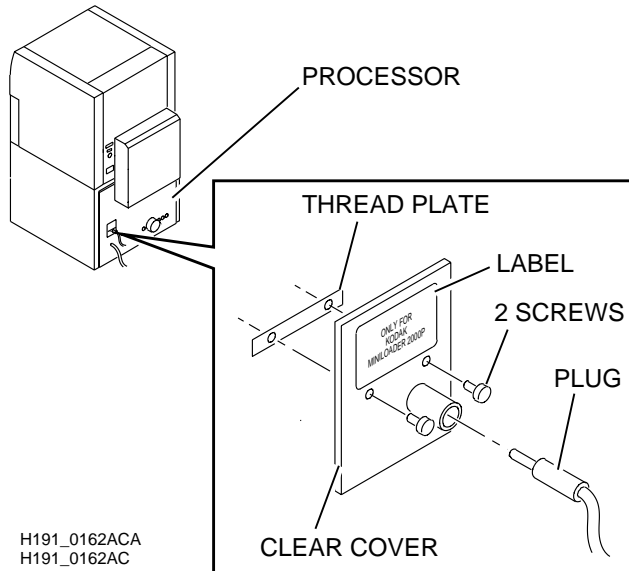

### Warning

Dangerous Voltage


- [1] De-energize the PROCESSOR.
- [2] Disconnect the PLUG.



### Caution

Prevent the THREAD PLATE from falling into the PROCESSOR.

- [3] Loosen the 2 SCREWS.
- [4] Rotate the CLEAR COVER with LABEL.
- [5] Remove:
  - 2 SCREWS
  - CLEAR COVER with LABEL
  - THREAD PLATE
- [6] Keep:
  - 2 SCREWS
  - THREAD PLATE
- [7] Discard the CLEAR COVER with LABEL.

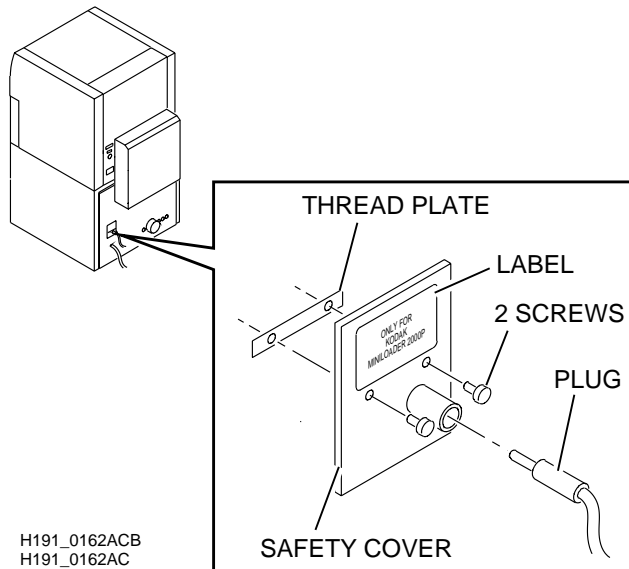

- [8] Install:
  - new black SAFETY COVER with LABEL
  - THREAD PLATE
  - 2 SCREWS
- [9] Connect the PLUG.

---

## Completing the Modification



### Warning

Dangerous Voltage

- [1] Energize the PROCESSOR.
- [2] Check that the equipment operates correctly.
- [3] Circle "13" on the MODIFICATION LABEL.
- [4] Record the information for feedback:

K-number	Service Code	Serial No.	Activity Code	Installation Time	Part No.
	3479		M13		6F6003

## Publication History

Publication Date	Publication No.	ECO No.	Changed Pages	File Name	Notes
25MAR04	6F6195	4014-598	---	6f6195.fm	New Publication

*Kodak* and *Min-R* are trademarks of Eastman Kodak Company.